

## **Temposonics**<sup>®</sup> Magnetostrictive Linear Position Sensors



#### Temposonics® E-Series

Brief Instructions

#### Table of contents

1.	Introduction	3
2.	Safety instructions	4
	2.1 Intended use	4
	2.2 Forseeable misuse	
	2.3 Installation, commissioning and operation	
	2.4 Safety instructions for use in explosion-hazardous areas	
	2.5 Warranty	
	2.6 Return	
	2.7 Maintenance & removal	
3.	Identification	
•	3.1 Temposonics® E-Series EH	
	3.2 Temposonics® E-Series EP	6
	3.3 Temposonics® E-Series EL	7
	3.4 Temposonics® E-Series EP2	7
	3.5 Temposonics® E-Series ER	7
4.	Installation & mounting	
	4.1 Sensor mounting	8
	4.2 Magnet installation	9
	4.3 Mounting dimensions of E-Series	
	4.4 Multi-position measurement distances	.11
5.	Electrical connections	
	5.1 Analog	
	5.2 Start / Stop	.13
	5.3 SSI	
	5.4 CANopen	
	5.5 IO-Link	

#### 1. Introduction

#### 1.1 Purpose and use of this manual

Before starting the operation of Temposonics<sup>®</sup> position sensors read this documentation thoroughly and follow the safety information. Keep the manual for future reference!

The content of this technical documentation is intended to provide information on mounting, installation and commissioning by qualified automation personnel<sup>1</sup> or instructed service technicians, who are familiar with the project planning and dealing with Temposonics<sup>®</sup> position sensors.

#### 1.2 Used symbols and warnings

Warnings are intended for your personal safety and for avoidance of damage to the described product or connected devices. In this documentation, safety information and warnings to avoid danger that might affect the life and health of operating or service personnel or cause material damage are highlighted by the preceding pictogram, which is defined below.

Symbol	Meaning
NOTICE	This symbol is used to point to situations that may lead to material damage, but not to personal injury.

- 1/ The term qualified technical personnel characterizes persons who:
  - are familiar with the safety concepts of automation technology applicable to the particular project
  - are competent in the field of electromagnetic compatibility (EMC)
  - have received adequate training for commissioning and service operations
  - are familiar with the operation of the device and know the information required for correct operation provided in the product documentation

#### 2. Safety instructions


#### 2.1 Intended use

This product may be used only for the applications defined under item 1 and only in conjunction with the third-party devices and components recommended or approved by MTS Sensors. As a prerequisite of proper and safe operation the product requires correct transport, storage, mounting and commissioning and must be operated with utmost care.

 The sensor systems of all Temposonics<sup>®</sup> series are intended exclusively for measurement tasks encountered in industrial, commercial and laboratory applications. The sensors are considered as system accessories and must be connected to suitable evaluation electronics, e.g. a PLC, IPC, indicator or other electronic control unit.

#### 2.2 Forseeable misuse

Forseeable misuse	Consequence
Wrong sensor connection	The sensor will not work properly or will be destroyed
Operate the sensor out off the operating temperature	No signal output The sensor can be damaged
Power supply is out of the defined range	Signal output is wrong / no signal output / the sensor will be damaged
Position measurement is influenced by an external magnetic field	Signal output is wrong
Cables are damaged	Short circuit – the sensor can be destroyed / sensor does not respond
Spacers are missing / are installed in a wrong order	Error in position measurement
Wrong connection of ground / shield	Signal output is disturbed The electronics can be damaged
Use of a magnet that is not certified by MTS Sensors	Error in position measurement

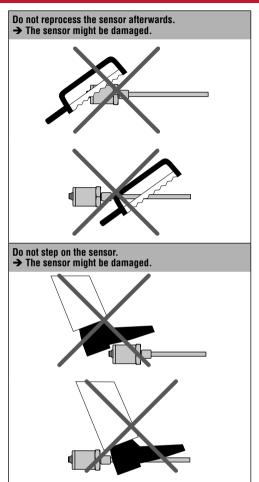

Manuals, Software & 3D Models available at: www.mtssensors.com

#### 2.3 Installation, commissioning and operation

The position sensors must be used only in technically safe condition. To maintain this condition and to ensure safe operation, installation, connection and service, work may be performed only by qualified technical personnel. If danger of injury to persons or of damage to operating equipment is caused by sensor failure or malfunction, additional safety measures such as plausibility checks, limit switches, EMERGENCY STOP systems, protective devices etc. are required. In the event of trouble, shut down the sensor and protect it against accidental operation.

#### Safety instructions for commissioning

To maintain the sensor's operability, it is mandatory to follow the instructions given below.

- 1. Protect the sensor against mechanical damage during installation and operation.
- 2. Do not open or dismantle the sensor.
- 3. Connect the sensor very carefully and pay attention to the polarity of connections and power supply.
- 4. Use only approved power supplies.
- 5. It is indispensable to ensure that the specified permissible limit values of the sensor for operating voltage, environmental conditions, etc. are met.
- 6. Check the function of the sensor regularly and provide documentation of the checks.
- 7. Before applying power, ensure that nobody's safety is jeopardized by starting machines.

### 2.4 Safety instructions for use in explosion-hazardous areas

The sensors are not suitable for operation in explosionhazardous areas.

#### 2.5 Warranty

MTS Sensors grants a warranty period for the Temposonics® position sensors and supplied accessories relating to material defects and faults that occur despite correct use in accordance with the intended application <sup>2</sup>. The MTS Sensors obligation is limited to repair or replacement of any defective part of the unit. No warranty can be provided for defects that are due to improper use or above average stress of the product, as well as for wear parts. Under no circumstances will MTS Sensors accept liability in the event of offense against the warranty rules, no matter if these have been assured or expected, even in case of fault or negligence of the company. MTS Sensors explicitly excludes any further warranties. Neither the company's representatives, agents, dealers nor employees are authorized to increase or change the scope of warranty.

#### 2.6 Return

For diagnostic purposes, the sensor can be returned to MTS Sensors. Any shipment cost is the responsibility of the sender <sup>2</sup>. For a corresponding form, see detailed operation manual (available at: www.mtssensors.com).

#### 2.7 Maintenance & removal

#### Error conditions, troubleshooting

See detailed operation manual (available at: www.mtssensors.com).

#### Maintenance

The sensor is maintenance-free.

#### Repair

Repairs of the sensor may only be performed by MTS Sensors or a repair facility explicitly authorized by MTS Sensors.

#### List of spare parts

No spare parts are available for this series.

#### **Transport and storage**

The conditions of transport and storage of the sensor match the operating conditions mentioned in this document.

#### Removal from service / dismantling


The product contains electronic components and must be disposed of in accordance with the local regulations.

2/ See also applicable MTS Sensors terms of sales and delivery on www.mtssensors.com


#### Temposonics® E-Series

Brief Instructions


#### 3. Identification

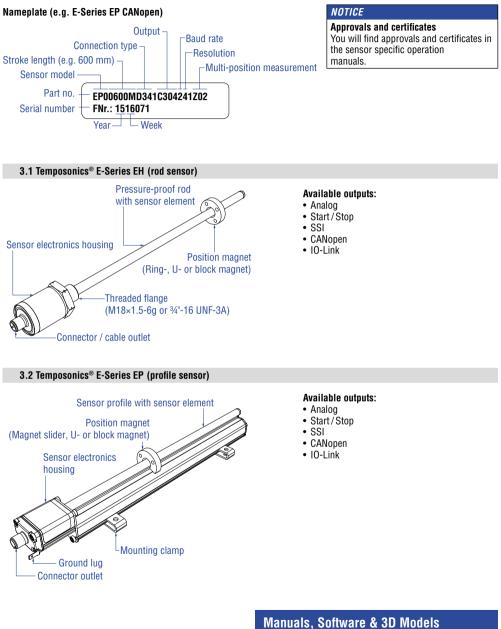

available at: www.mtssensors.com

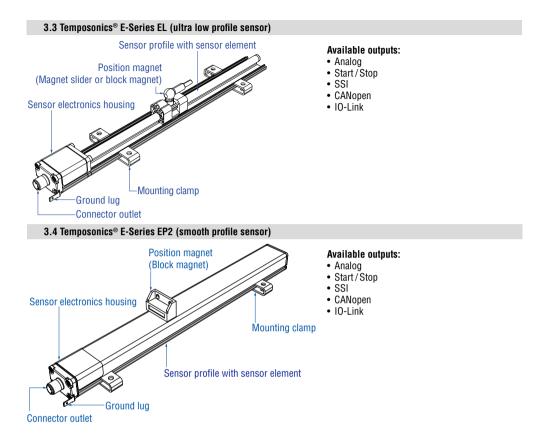

#### 3.5 Temposonics® E-Series ER (rod & cylinder housing)

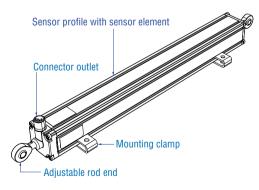

#### Available outputs:

- Analog
- Start / Stop
- SSI
- CANopen
- IO-Link

Manuals, Software & 3D Models available at: www.mtssensors.com

#### 4. Installation & mounting

#### 4.1 Sensor mounting

#### Rod sensors – E-Series EH

- Fix the sensor rod via threaded flange.
- Note the fastening torque of 50 Nm.
- Seat the flange contact surface completely on the cylinder mounting surface
- The cylinder manufacturer determines the pressureresistant gasket (copper gasket, O-ring, etc.).
- The position magnet should not grind on the sensor rod.
- The piston rod drilling (Ø 10 mm rod:  $\ge$  Ø 13 mm ( $\ge$  Ø 0.52 in.) borehole / Ø 7 mm rod:  $\ge$  Ø 10 mm ( $\ge$  Ø 0.4 in.) borehole) depends on the pressure and piston speed.
- · Adhere to the information relating to operating pressure.
- Protect the sensor rod against wear.

#### NOTICE

For detailed mounting instructions see operation manual.

#### Sensors with stroke lengths $\ge 1$ meter ( $\ge 3.3$ ft)

Support horizontally installed sensors with a stroke length from 1 meter (3.3 ft) mechanically at the rod end. Without the use of a support, rod and position magnet may be damaged. A false measurement result is also possible.

Longer rods require evenly distributed mechanical support over the entire length (e.g. part no. 561 481). Use an U-magnet for measurement.

#### Sensor support

 
(for sensors with stroke lengths ≥ 1 meter (≥ 3.3 ft)) U-magnet Sensor rod Non-magnetic fixing clip

#### Profile sensors - E-Series EP / EL / ER / EP2

The sensor is fitted on a flat machine surface using mounting clamps. A length-dependent number of these clamps are delivered with the sensor and must be distributed over the profile at regular distances.

For fastening, we recommend using M5×20 screws (according to DIN 6912) that should be tightened with a fastening torque of 5 Nm.


#### Mounting clamps



Screw: M5×20 (DIN 6912) Fastening torque: 5 Nm

#### NOTICE

Do not raise up the ER sensor, if the lifting rod is extended.

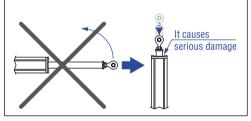

#### Temposonics<sup>®</sup> E-Series Brief Instructions

#### 4.2 Magnet installation

Typical use of magnets					
Ring magnet	For: EH • Rotationally symmetrical magnetic field				
U-magnet	For: EH & EP • Height tolerances can be compensated				
Block magnet	For: EP, EL, EP2 & EH • The magnet can be lifted off • Height tolerances can be compensated				
Magnet slider	For: EP & EL • The magnet is guided through the profile • The distance between the magnet and the wavenuide is strictly defined				

Easy coupling via the ball joint

#### Mounting ring magnets, U-magnets & block magnets

Install the magnet using non-magnetic material for mounting device, screws, spacers etc.. The magnet must not grind on the sensor rod. Alignment errors are compensated via the air gap.


- Permissible surface pressure: Max. 40 N/mm<sup>2</sup> (only for ring magnets and U-magnets)
- Fastening torque for M4 screws: 1 Nm; use washers, if necessary
- Minimum distance between position magnet and any magnetic material has to be 15 mm (0.6 in.).
- If no other option exists and magnetic material is used, observe the specified dimensions.


#### NOTICE

Mount ring magnets and U-magnets concentrically. Mount block magnets centrically over the sensor rod or the sensor profile.

Do not exceed the maximum acceptable gap. Take care to mount the sensor in an axially parallel position to avoid damage of the carriage, magnet and sensor rod.

#### Centered mounting of block magnet

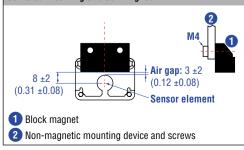


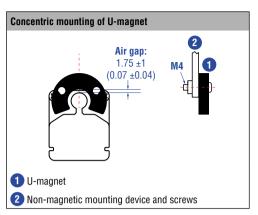

#### Magnet mounting with magnetic material

When using magnetic material the dimensions must be observed.

- A. If the position magnet aligns with the drilled piston rod
- **B.** If the position magnet is set further into the drilled piston
- rod, install another non-magnetic spacer above the magnet

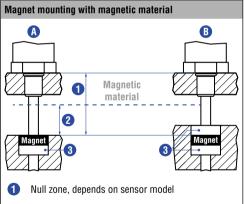


- 2 Distance between position magnet and any magnetic material ( $\geq$  15 mm ( $\geq$  0.6 in.))
- Non-magnetic spacer ( $\geq 5 \text{ mm} (\geq 0.2 \text{ in.})$ ) Recommendation: 8 mm (0.31 in.)

Controlling design dimensions are in millimeters and measurements in ( ) are in inches

#### 4.3 Mounting dimensions of E-Series

Consider the start and end positions of the position magnets during the installation. To ensure that the entire stroke length is electrically usable, the position magnet must be mechanically mounted as follows.

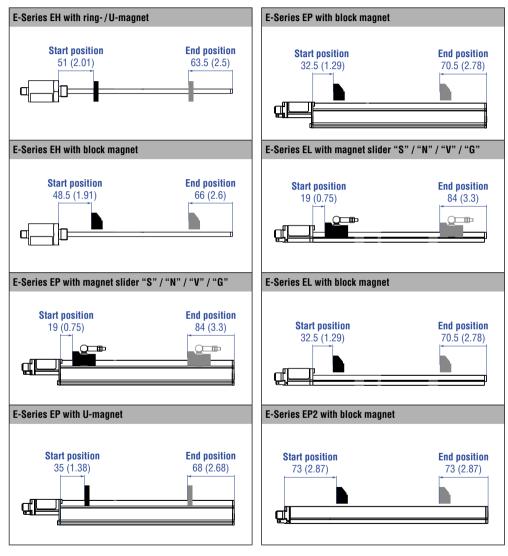

#### Manuals, Software & 3D Models available at: www.mtssensors.com

The mounting position of the sensor is arbitrary.


Controlling design dimensions are in millimeters and measurements in ( ) are in inches

NOTICE

#### 4.4 Multi-position measurement distances

Multi-position measurement with E-Series EH, EP, EL and EP2 sensors with Analog and CANopen output is possible with a simultaneous measuring up to 2 positions.

The stroke length influences the maximum number of magnets. Note the minimum distance between the magnets.

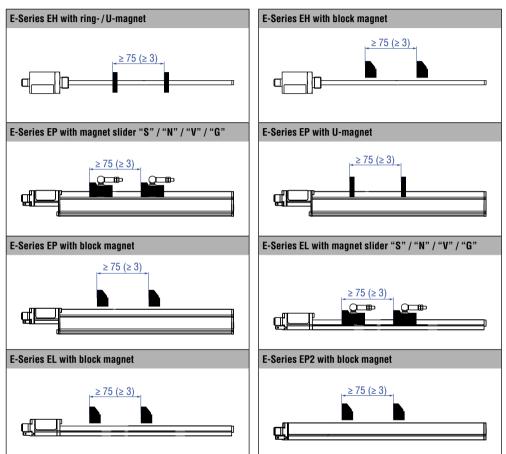

#### NOTICE

Use magnets of the same type for multi-position measurement, e.g. 2 × U-magnets (part no. 251 416-2).

Controlling design dimensions are in millimeters and measurements in ( ) are in inches

Manuals, Software & 3D Models available at: www.mtssensors.com

#### 5. Electrical connections

Placement of installation and cabling have decisive influence on the sensor's electromagnetic compatibility (EMC). Hence correct installation of this active electronic system and the EMC of the entire system must be ensured by using suitable metal connectors, shielded cables and grounding. Overvoltages or faulty connections can damage its electronics despite protection against wrong polarity.

#### NOTICE

- 1.Do not mount the sensors in the area of strong magnetic or electric noise fields.
- 2.Never connect / disconnect the sensor when voltage is applied.

#### Instructions for connection

- Use low-resistant twisted pair and shielded cables. Connect the shield to ground externally via the controller equipment.
- Keep control and sign leads separate from power cables and sufficiently far away from motor cables, frequency inverters, valve lines, relays, etc..
- Use only connectors with metal housing and connect the shielding to the connector housing. Connect the cable clamps to function as a ground.
- Keep the connection surface at both shielding ends as large as possible.
- · Keep all non-shielded leads as short as possible.
- Keep the earth connection as short as possible with a large cross section. Avoid ground loops.
- With potential differences between machine and electronics earth connections, no compensating currents are allowed to flow across the cable shielding. Recommendation:


Install potential compensating leads with large cross

section, or use cables with separate double shielding, and connect only one end of the shield.

 Use only stabilized power supplies in compliance with the specified connecting values.

#### NOTICE

Connect the sensor electronics housing to machine ground. Ground sensor types EP, EL, ER and EP2 via ground lug as shown. Ground the sensor type EH via thread.

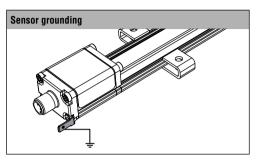

#### 5.1 Analog

D34		
Signal + power supply		
M12 male connector (A-coded)	Pin	Function
	1	+24 VDC (-15 / +20 %)
	2	Output 1
(890)	3	DC Ground (0 V)
	4	Output 2
View on sensor	5	DC Ground

#### EH with cable outlet (EHX / ETX)

Signal + power supply			
Cable	Color	Function	
	GY	Output 1	
	PK	GND (Signal)	
	YE	Output 2	
	GN	Not connected	
	BN	+24 VDC (-15 / +20 %)	
	WH	DC Ground (0 V)	

#### 5.2 Start/Stop

D84				
Signal + power supply				
M12 male connector (A-coded)	Pin	Function		
	1	Start (+)		
	2	Start (-)		
	3	Stop (+)		
(000)	4	Stop (-)		
\0 <sub>0</sub> 0	5	Not connected		
View on sensor	6	Not connected		
	7	+24 VDC (-15 / +20 %)		
	8	DC Ground (0 V)		

EH with cable outlet (EHX / ETX)			
Signal + power supply			
Cable	Color	Function	
	GY	Stop (-)	
	PK	Stop (+)	
	YE	Start (+)	
	GN	Start (-)	
	BN	+24 VDC (-15 / +20 %)	
	WH	DC Ground (0 V)	

#### Temposonics® E-Series

**Brief Instructions** 

#### 5.3 SSI

D84				
Signal + power supply				
M12 male connector (A-coded)	Pin	Function		
	1	Clock (+)		
	2	Clock (-)		
	3	Data (+)		
	4	Data (-)		
	5	Not connected		
	6	Not connected		
	7	+24 VDC (-15 / +20 %)		
	8	DC Ground (0 V)		

# EH with cable outlet (EHX / ETX) Signal + power supply Cable GY Data (-) OV

🖄 WH

Color	Function
 GY	Data (-)
PK	Data (+)
 YE	Clock (+)
GN	Clock (-)
BN	+24 VDC (-15 / +20 %)

DC Ground (0 V)

#### 5.4 CANopen

D34		
Signal + power supply		
M12 male connector (A-coded)	Pin	Function
$\frown$	1	Shield
	2	+24 VDC (-15 / +20 %)
(890)	3	DC Ground (0 V)
	4	CAN_H
View on sensor	5	CAN_L

#### EH with cable outlet (EHX / ETX) Signal + power supply Cable Color Function GY CAN\_L ΡK CAN\_H YE Not connected GN Not connected ΒN +24 VDC (-15 / +20 %) WH DC Ground (0 V)

#### 5.5 IO-Link

D44		
Signal + power supply		
M12 male connector (A-coded)	Pin	Function
	1	+24 VDC (+25 %)
(0ັ0)	2	DI / DQ
	3	DC Ground (0 V)
View on sensor	4	C / Q

Notes	



MTS Systems Corporation	3001 Sheldon Drive Cary, N.C. 27513 Phone: +1 919 677-0100 E-mail: info.us@mtssensors.com	Document Part No: 551684 Revision C (EN) 05/2017
<b>GERMANY</b> MTS Sensor Technologie GmbH & Co. KG		
	Phone: +39 030 988 3819 E-mail: info.it@mtssensors.com	
	Phone: +33 1 58 4390-28 E-mail: info.fr@mtssensors.com	
	Phone: +44 79 44 15 03 00 E-mail: info.uk@mtssensors.com	
	Phone: +86 86 21 2415 1000 / 2415 1001 E-mail: info.cn@mtssensors.com	
	Phone: +81 42 707 7710 E-mail: info.jp@mtssensors.com	

#### www.mtssensors.com

MTS, Temposonics and Level Plus are registered trademarks of MTS Systems Corporation in the United States; MTS SENSORS and the MTS SENSORS logo are trademarks of MTS Systems Corporation within the United States. These trademarks may be protected in other countries. All other trademarks are the property of their respective owners. Copyright © 2018 MTS Systems Corporation. No license of any intellectual property rights is granted. MTS reserves the right to change the information within this document, change product designs, or withdraw products from availability for purchase without notice. Typographic and graphics errors or missions are uniterinoial and subject to correction. Visit www.mtssensors.com for the lates product information.