



Absolute, Non-Contact Position Sensors

OPERATION MANUAL E-Series Embedded Analog



Table of contents

1.	Introduction	.2
	1.1 Purpose and use of this manual	2
	1.2 Used symbols and warnings	2
2.	Safety instructions	
	2.1 Intended use	
	2.2 Installation, commissioning and operation	3
	2.3 Safety instructions for use in explosion-hazardous areas	
	2.4 Warranty	
	2.5 Return	
3.	Identification	
	3.1 Order structure	4
	3.2 Nameplate (example)	
	3.3 Approvals	
	3.4 Scope of delivery	5
4.	Product description and commissioning	
	4.1 Functionality and system design	5
	4.2 Styles and installation	
	4.3 Electrical connection	
	4.4 Accessories	10
5.	Operation	12
	5.1 Getting started	12
	5.2 Programming and configuration	12
	5.3 Configuration example	12
6.	Maintenance and troubleshooting	12
	6.1 Error conditions, troubleshooting	12
	6.2 Maintenance	12
	6.3 Repair	12
	6.4 List of spare parts	
7.	Removal from service/dismantling	12
	7.1 Disposal	12
8.	Technical data	13
	8.1 Input	
	8.2 Output	
	8.3 Performance	
	8.4 Operating conditions	
	8.5 Design and material	
	8.6 Installation	
	8.7 Power supply	
	8.8 Electrical connection	
9.	Annex	14
	Return sheet	14

1. Introduction

1.1 Purpose and use of this manual

Before starting the operation of Temposonics[®] sensors, please, read this documentation thoroughly and follow the safety information.

The content of this technical documentation and of its various annexes is intended to provide quick information on mounting, installation and commissioning by qualified automation personnel ¹ or instructed service technicians who are familiar with the project planning and dealing with Temposonics[®] sensors.

1.2 Used symbols and warnings

Warnings are intended for your personal safety and for avoidance of damage to the described product or connected devices. In this documentation, safety information and warnings to avoid dangers that might affect the life and health of operating or service personnel or cause material damage are highlighted by the preceding pictogram, which is defined below.

Symbol	Meaning
NOTICE	This symbol is used to point to situations that may lead to material damage, but not to personal injury.

2. Safety instructions

2.1 Intended use

This product may be used only for the applications provided in the technical description and only in conjunction with third-party devices and components recommended or approved by MTS. As a prerequsite of proper and safe operation, the product requires correct transport, storage, mounting and commissioning and must be operated with utmost care.

- The sensor systems of all Temposonics[®] series are intended exclusively for measurement tasks encountered in industrial, commercial and laboratory applications. The sensors are considered as system accessories and must be connected to suitable evaluation electronics, e.g. a PLC, IPC, indicator or other electronic control unit.
- The position sensors must be used only in technically safe condition. To maintain this condition and to ensure safe operation, installation, connection and service work may be performed only by qualified technical personnel.

1/ The term "qualified technical personnel" characterizes persons who: - are familiar with the safety concepts of automation technology applicable to the

particular project.

⁻ are competent in the field of EMC

 ^{1/ -} have received adequate training for commissioning and service operations
- are familiar with the operation of the device and know the information required for correct operation provided in the product documentation.

2.2 Installation, commissioning and operation

If danger of injury to persons or of damage to operating equipment is caused by sensor failure or malfunction, additional safety measures such as plausibility checks, limit switches, EMERGENCY OFF systems, protective devices etc. are required. In the event of trouble, shut down the sensor and protect it against accidental operation.

Installation, operation

To maintain the sensor operability, it is mandatory to follow the instructions given below.

- 1. Protect the sensor against mechanical damage during installation and operation.
- 2. Do not open or dismantle the sensor.
- 3. Connect the sensor very carefully and pay attention to the polarity of connections, power supply as well as to the shape and duration of control pulses.
- 4. Use only approved power supplies.
- 5. It is indispensable to ensure that the specified permissible limit values of the sensor for supply voltage, environmental conditions, etc. are met.
- 6. Check the function of the sensor regularly and provide documentation of the checks.
- 7. Before system switch-on, ensure that nobody's safety is jeopardized by starting machines.

2.3 Safety instructions for use in explosion-hazardous areas

The sensor is not suitable for operation in explosion-hazarded areas.

2.4 Warranty ²

MTS grants a warranty period for the Temposonics[®] position sensors and supplied accessories relating to material defects and faults that occur despite correct use in accordance with the intended application ². The MTS obligation is limited to repair or replacement of any defective part of the unit. No warranty can be taken for defects that are due to improper use or above average stress of the product, as well as for wear parts. Under no circumstances will MTS accept liability in the event of offense against the warranty rules, no matter if these have been assured or expected, even in case of fault or negligence of the company.

MTS explicitly excludes any further warranties. Neither the company's representatives, agents, dealers nor employees are authorized to increase or change the scope of warranty.

2.5 Return

For diagnostic purposes, the sensor can be returned to MTS Sensor Technologie GmbH. Any shipment cost will be borne by the sender ². A corresponding return form is included in annex.

3. Identification

-		
3.1 Order structure		
1 2 3 4 5 6 E E S a b C	7 8 9 10 11 12 1 1 10 1 1 1	13 14 15
a Sensor model		e Operating voltage
E E Rod		1 +24 VDC (-15 / +20 %)
b Design		f Output
S Pressure fit flange, 10 mm roo	d-Ø	A O 1 420 mA
		A 1 1 204 mA
c Stroke length		
X X X X M 00502540		
X X X X U 002.0100.0) in.	
Standard stroke length (mm)*		
Stroke length	Ordering steps	
50 500 mm	5 mm	
500 750 mm	10 mm	
7501000 mm	25 mm	
10002540 mm	50 mm	
Standard stroke length (in.)*		
Stroke length	Ordering steps	
2 20 in.	0.2 in.	
20 30 in.	0.5 in.	
30 40 in.	1.0 in.	
40100 in.	2.0 in.	
d Connection type		
	TM connector system	
M 1 1 6 pin molex PicoBlade Cable length 110 mm	er connector system	
M 3 1 6 pin molex PicoBlade Cable length 310 mm	o™ connector system	
M 6 1 6 pin molex PicoBlade Cable length 610 mm	[™] connector system	

3.2 Nameplate (example)				
Order code (Part no.)	EE X XXXXX XXX X XX)		
Coding depending on output	_xxxxxxxx			
Serial no.	FNr. 1320 0376			

3.3 Approvals

The sensor conforms to the EU directives and is provided with CE marking.

3.4 Scope of delivery

Sensor with installed back-up ring and O-ring.

4. Product description and commissioning

4.1 Functionality and system design

Product designation

- Position sensor Temposonics® E-Series

Construction series

- Temposonics® EE (rod-shaped housing)
- Stroke length 50...2540 mm
- Output signal: analog

Application

The Temposonics[®] sensor is used for measurement and conversion of the position variable in the field of automated system and mechanical engineering.

Principle of operation and system construction

For position measurement, the absolute, linear Temposonics[®] position sensors make use of the properties offered by the specially designed magnetostrictive waveguide. Inside the sensor a torsional strain pulse is induced in the waveguide by momentary interaction of two magnetic fields. One field is produced by a moving position magnet, which travels along the outside of the sensor element. The other field is generated by a current pulse applied to the waveguide.

The interaction between these two magnetic fields produces a strain pulse, which is detected at the head of the sensor. The position of the moving magnet is determined precisely by measuring the time elapsed between the application of the current pulse and the arrival of the strain pulse. The result is a reliable position measurement system capable of ensuring accurate and repeatable measurement.

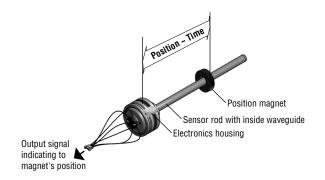


Fig. 1: Principle of operation: Magnetostrictive runtime measurement = position information

Modular mechanical and electronic construction

- The sensor rod protects the inside sensing element (waveguide).
- The electronics housing accommodates the complete electronic interface with active signal conditioning.
- The external position magnet is a permanent magnet. Mounted on the mobile machine part, it travels along the sensor and triggers the measurement through the wall of the sensor rod housing.
- The sensor can be connected directly to a control system. Its electronics generates a strictly position-proportional signal output between zero and end position.

4.2 Styles and installation

The pressure-resistant stainless steel rod is installed in the hydraulic cylinder under reduced space conditions. The position is measured contactlessly via a ring-shaped position magnet.

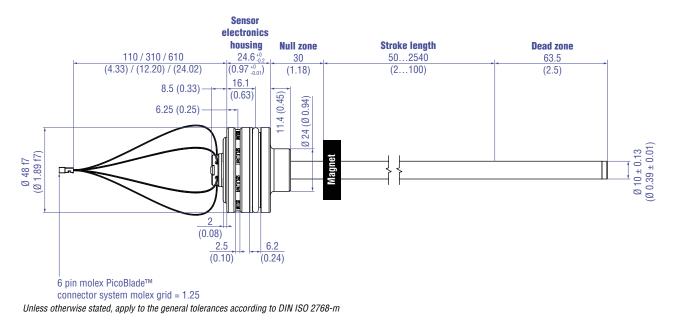


Fig. 2: Temposonics® EE

 
Active measuring range

 
The technical data of each sensor is checked as well as documented and the active measuring range (useful electrical stroke) with its span start and end (see Fig. 3) is adjusted during final inspection and testing.

NOTICE On all sensors, the areas left and right of the active measuring range are provided for mounting and damping of the measuring signal. They should not be used for measurement, but the active measuring range can be exceeded without problem.

Mechanical zero

To ensure that the entire measuring range can be used electrically, the position magnet must be mounted mechanically as follows (see Fig. 4).





Installation in a hydraulic cylinder

The mounting method is determined exclusively by the cylinder construction (Fig. 5). In most cases, the installation is performed from the side of the piston rod. However, installation from the piston side of the cylinder is also possible. In both cases, sealing of the cylinder is ensured by an O-ring and a back-up ring.

NOTICE When installing, please note:

- The position magnet must not drag on the measuring rod.
- The bore hole in the piston rod should be min. 13.5 mm. The specified operating pressures must be observed.


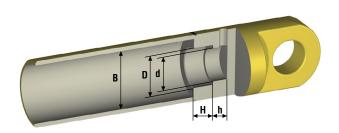


Fig. 5: Rod eye cylinder installation example

Туре	B	D	H	d	h
	Ø cylinder	Ø	Depth	Ø min.	Depth
EE	e.g. 52	48	24.6	> 37.5 < 40	> 15

Installing the position magnet in the piston

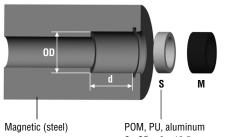

S=0D x 8 x 13.5 S: Spacer M: Magnet

Non-magnetic

C: Circlip

(stainless steel) W: Corrugated washer

Fig. 6: "Position magnet in piston" installation example

	Ring magnet OD25,4 Part no.: 400 533	Ring magnet OD33 Part no.: 201 542-2
OD	25.4 mm	33.0 mm
d	min. 16 mm *	min. 16 mm *

All dimensions in mm

*/ Without corrugated washer and circlip

O- and back-up ring positioning

O-ring and back-up ring are factory-fitted by MTS as shown in Fig. 7.

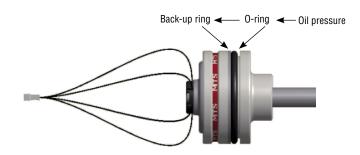


Fig. 7: Positioning of o-rings and back-up rings

Note on safeguarding by means of a threaded pin


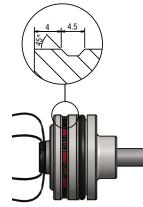


Fig. 8: Flange housing with O-Ring and back-up ring

 Fig. 9: e.g. Safeguarding by means of a threaded pin DIN 913 M5x10 (using a flat point) max. fastening torque 0.5 Nm



Load-bearing geometries on sensor housings

Only the surfaces marked in green may be loaded when mounting the sensor in the cylinder. Don't exert forces or even hammer strokes on the surfaces marked in red.


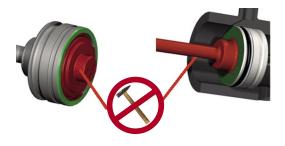



Fig. 10: Load-bearing geometries on sensor housings


Temposonics® E-Series Embedded Analog

Mounting in the cylinder



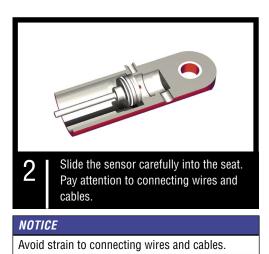

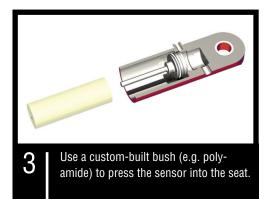

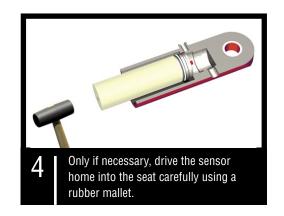

NOTICE

Never use a steel hammer. Avoid hard blows on the sensor or on the tools when mounting!

4.3 Electrical connection

Place of installation and cabling have decisive influence on the sensor EMC. Hence correct installation of this active electronic system and the EMC of the entire system must be ensured by using suitable metal connectors, shielded cables and grounding.

Overvoltages or faulty connections can damage its electronics despite protection against wrong polarity.

Instruction for connection

- Never connect the sensor when under voltage!
- Use low-resistance twisted pair and shielded cables and connect the shield to earth externally via the controller equipment.
- Control and signal leads should be kept separate from power cables and away from motor cables, frequency inverters, valve cables, switching relays, etc.
- Use only metal connectors and connect the shielding to the connector housing.
- Connect the shields at both cable ends via a large surface and connect the cable clamps to function earth.
- Keep all non-shielded leads as short as possible.
- Keep the earth connections short and with a large cross section and avoid ground loops.
- With potential differences between the earth connection of the machine and the electronics, no compensating current flowing over the shield is allowed. We recommend using an equipotential bonding conductor with large cross-section or a cable with separate dual shielding and connecting the shields only at one end.
- Use only stabilized power supplies and ensure that the specified connecting values are met.

CONNECTOR WIRING

With mating connector cable 254 256 and 254 560

5 pin connector	M12	Function
	Pin 1	+24 VDC (-15 / +20 %)
0	Pin 2	Output 1
(860)	Pin 3	DC Ground (0 V)
	Pin 4	-
	Pin 5	DC Ground

Fig. 11: Connector wiring with mating connector cable 254 256 and 254 560

With mating connector cable 254 266

6 pin molex connector	Molex	Color	Function
	Pin 1	YE	_
	Pin 2	—	—
	Pin 3	GY	Output 1
	Pin 4	WH	DC Ground (0 V)
	Pin 5	BK	DC Ground
Pin 1	Pin 6	BN	+24 VDC (-15 / +20 %)

Fig. 12: Connector wiring with mating connector cable 254 266

With extension cable 254 642-x

6 pin molex connector	Molex	Color	Function
	Pin 1	YE	—
	Pin 2	BL	-
	Pin 3	GY	Output 1
	Pin 4	WH	DC Ground (0 V)
	Pin 5	BK	DC Ground
Pin 1	Pin 6	BN	+24 VDC (-15 / +20 %)


Fig. 13: Connector wiring with extension cable 254 642-x

4.4 Accessories

FREQUENTLY ORDERED ACCESSORIES – Additional options available in our Accessories Guide 🗍 551444


Position magnets <u>Ø 32.8</u> (Ø 1.29) Ø 25.4 Ø 17.4 (Ø1) Ø43 (Ø 0.69) <u>Ø 23</u>.8 (Ø 0.17) Ø 13.5 (Ø 0.94) Ø 13.5 Ζ 7.9 (Ø 0.53) <u>7.9</u> (0.31) (0.31) <u>Ø 13.5</u> (Ø 0.53 (0.31)Ring magnet OD17.4 Standard ring magnet **Ring magnet 0D25.4** Part no. 401 032 Part no. 201 542-2 Part no. 400 533 Material: PA ferrite GF20 Material: PA ferrite Material: PA neobind Weight: Ca. 14 g Weight: Ca. 10 g Weight: Ca. 5 g Operating temperature: Operating temperature: Operating temperature: -40...+105 °C (-40...+221 °F) -40...+105 °C (-40...+221 °F) -40...+105 °C (-40...+221 °F) Surface pressure: Max. 40 N/mm² Surface pressure: Max. 40 N/mm² Surface pressure: Max. 20 N/mm² Fastening torque for M4 screws: 1 Nm

 Cable connectors³



Female, straight, 5 pin, M12 Part no. 370 677


Housing: GD-Zn, Ni / IP67 Termination: Screw; max. 0.75 mm² Contact insert: CuZn Cable Ø: 4...8 mm (0.16...0.31 in.) Fastening torque: 0.6 Nm

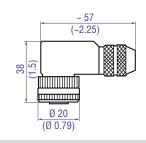

Female, angled, 5 pin, M12 Part no. 370 678

Housing: GD-Zn, Ni / IP67 Termination: Screw; max. 0.75 mm² Contact insert: CuZn Cable Ø: 5...8 mm (0.2...0.31 in.) Fastening torque: 0.6 Nm

Controlling design dimensions are in millimeters and measurements in () are in inches 3/ Follow the manufacturer's mounting instructions when connecting the connectors

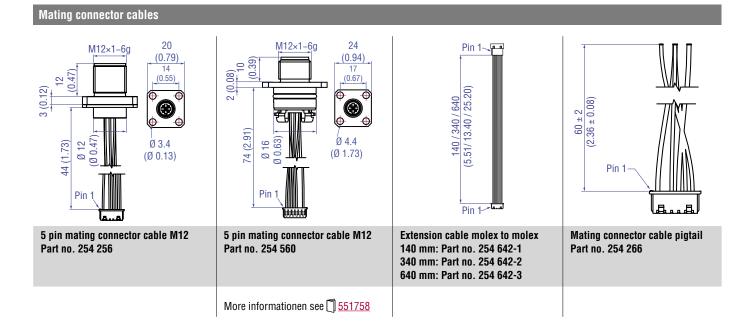

5.Operation

5.1 Getting started

- 1. Before initial switch-on, check carefully if the sensor has been connected correctly.
- 2. Ensure that the sensor control system cannot be displaced in an uncontrolled way when switching on.
- 3. After switching on, the sensor is ready for operation and in operating mode.
- 4. Check the preset span start and end values (see section 4.2).

5.2 Programming and configuration

The sensor is factory-set and adjusted to its ordering variables, i.e. the required output signal corresponds exactly to the selected stroke length.

Example: output 4...20 mA = 0...100 % stroke length

5.3 Configuration example

Omitted.

6. Maintenance and troubleshooting

6.1 Error conditions, troubleshooting

The sensor doesn't send a position signal - Check the supply voltage.

6.2 Maintenance

The sensor is maintenance-free.

6.3 Repair

Repairs on the sensor may be performed only by MTS or an explicitly authorized body.

6.4 List of spare parts

Omitted.

7. Removal from service / dismantling

7.1 Disposal

The product contains electronic components and must be disposed of in accordance with the local regulations.

8. Technical data

8.1 Input		
Measured value	position	
Stroke length	502540 mm	
8.2 Output		
1. Current	420 mA or 204 mA (min/max. load: 0/500 Ohms)	
8.3 Performance		
Resolution	infinite	
Linearity ⁴	\leq ± 0.02 % F.S. (minimum ± 60 µm)	
Repeatability	\leq ± 0.002 % F.S. (minimum ± 20 µm)	
Sample rate	\leq 3 kHz	
Ripple	≤ 0.01 % F.S.	
8.4 Operating conditions		
Mounting position	any	
Magnet movement velocity	any	
Operating temperature	-40 °C+85 °C	
Dew point, humidity	90 % rel. humidity, no condensation	
Ingress protection	IP67 (with professional mounted housing and connectors), sensor with flat connector IP30	
Shock test 100 g (single shock) IEC-Standard 60068-2-27		
Vibration test	15 g / 102000 Hz IEC-Standard 60068-2-6 (resonance frequencies excluded)	
EMC test	Electromagnetic emission EN 55011, cl. B:2009 + A1:2010 Electromagnetic immunity EN 61326-1:2006	
8.5 Design and material		
Electronics housing	stainless steel 1.4301 / AISI 304	
Rod	stainless steel 1.4301 / AISI 304 10 mm rod: 350 bar, 530 bar peak	
Position magnet	ring magnet, PA-Ferrite	
8.6 Installation		
Mounting type	embedded	
Mounting position	any	
8.7 Power supply		
Supply voltage	24 VDC (+20 % / -15 %)	
Current consumption	50140 mA	
Ripple	≤ 0.28 Vpp	
8.8 Electrical connection		
Connection type	6 pin molex	
Dielectric strength	500 VDC (0 V ground to machine ground)	
Polarity protection	up to -30 VDC	
Overvoltage protection	up to 36 VDC	
overvollage protection		

4/ with position magnet # 201 542-2



9. Anhang

Safety Declaration

Dear Customer,

If you return one or several for checking or repair, we need you to sign a safety declaration. The purpose of this declaration is to ensure that the returned items do not contain residues of harmful substances and / or that any danger to persons when handling these items is excluded.

MTS order number:	 Sensor type(s):
Serial number(s):	 Sensor length:

The sensor has been in contact with the following materials:

Don't specify chemical formulas. Please, include safety data sheets of the substances, if applicable. In the event of suspected penetration of substances into the sensor, consult MTS to determine measures to be taken before shipment, if necessary.

Short description of malfunction:

Corporate information	Contact partner
Company:	Name:
Address:	Phone:
	E-Mail:

We hereby certify that the measuring equipment has been cleaned and neutralized. Equipment handling is safe. Personnel exposure to health risks during transport and repair is excluded.

Stamp

Signature

Date

MTS Sensor Technologie GmbH & Co.KG Auf dem Schüffel 9 58513 Lüdenscheid, Germany Tel. +49-23 51-95 87 0 Fax +49-23 51-5 64 91 info@mtssensor.de www.mtssensor.com



Document Part number:

551415 Revision B (EN) 03/2016

LOCATIONS

MTS Systems Corporation Sensors Division 3001 Sheldon Drive Cary, N.C. 27513, USA Tel. +1 919 677-0100 Fax +1 919 677-0200 info.us@mtssensors.com www.mtssensors.com

JAPAN

USA

MTS Sensors Technology Corp. 737 Aihara-machi, Machida-shi, Tokyo 194-0211, Japan Tel. +81 42 775-3838 Fax +81 42 775-5512 info.jp@mtssensors.com www.mtssensors.com

FRANCE

MTS Systems SAS Zone EUROPARC Bâtiment EXA 16 16/18, rue Eugène Dupuis 94046 Creteil, France Tel. + 33 1 58 4390-28 Fax + 33 1 58 4390-03 info.fr@mtssensors.com www.mtssensors.com

GERMANY MTS Sensor Technologie GmbH & Co. KG Auf dem Schüffel 9 58513 Lüdenscheid, Germany Tel + 49 2351 9587-0

58513 Ludenscheid, Germ Tel. + 49 2351 9587-0 Fax + 49 2351 56491 info.de@mtssensors.com www.mtssensors.com

CHINA

MTS Sensors Room 504, Huajing Commercial Center, No. 188, North Qinzhou Road 200233 Shanghai, China Tel. +86 21 6485 5800 Fax +86 21 6495 6329 info.cn@mtssensors.com www.mtssensors.com

ITALY

MTS Systems Srl. Sensor Division Via Diaz,4 25050 Provaglio d'Iseo (BS), Italy Tel. + 39 030 988 3819 Fax + 39 030 982 3359 info.it@mtssensors.com www.mtssensors.com MTS, Temposonics and Level Plus are registered trademarks of MTS Systems Corporation in the United States; MTS SENSORS and the MTS SENSORS logo are trademarks of MTS Systems Corporation within the United States. These trademarks may be protected in other countries. All other trademarks are the property of their respective owners. Copyright © 2016 MTS Systems Corporation. No license of any intellectual property rights is granted. MTS reserves the right to change the information within this document, change product designs, or withdraw products from availability for purchase without notice. Typographic and graphics errors or omissions are unintentional and subject to correction. Visit www.mtssensors.com for the latest product information.



LEGAL NOTICES